STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 B. WING HAL012004 12/29/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 3806 KATHY ROAD **MCALPINE ADULT CARE** MORGANTON, NC 28655 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 000 Initial Comments C 000 Report of Biennial Construction Survey by Dennis Harrell and Bob Getchell on 12-29-2015. Records indicate this facility was first licensed on 5-1-1977. The facility is licensed for 60 beds. Based on this information, the facility is required to meet the 1977 Minimum and Desired Standards and Regulations for Homes for the Aged and Infirm and the 1967 Edition of the North Carolina State Building Code Group D Institutional. C 111 Must Have Current San. & Fire Safety Reports C 111 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0302 DESIGN AND CONSTRUCTION(f) The facility shall have current sanitation and fire and building safety inspection reports which shall be maintained in the home and available for review. This Rule is not met as evidenced by: Based on a review of documents, the most recent sanitation report for the building was dated 8-22-2014. Sanitation inspections are required at least annually. C 133 Bathrooms-Hand Grips C 133 SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL **ENVIRONMENT** (e) The requirements for bathrooms and toilet rooms are: (6) Hand grips shall be installed at all commodes, tubs and showers used by or accessible to residents:

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE (X6) DATE

STATEMENT OF DEFICIENCIES (X1) PROV		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01		(X3) DATE SURVEY COMPLETED	
		HAL012004	B. WING		12/2	9/2015
NAME OF F	PROVIDER OR SUPPLIER	STREET ADI	DRESS, CITY, S	STATE, ZIP CODE	•	
MCAI PI	NE ADULT CARE	3806 KATI				
			TON, NC 28			
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES / MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCED TO THE APPROINT DEFICIENCY)	D BE	(X5) COMPLETE DATE
C 133	Continued From pa	ge 1	C 133			
	missing at a toilet in	et as evidenced by: on, the hand grips were n the big men's bathroom and oom near bedroom 14.				
C 164	Housekeeping and	Furnishings-Clean, Repaired	C 164			
	FURNISHINGS (a) Adult care home (1) have walls, ceil coverings kept clea (2) have no chronic (3) have furniture of	06 HOUSEKEEPING AND				
	This Rule is not me 1. Based on obser- clean in at least bed	vation, the floor was not kept				
	in good repair. Findings include: a. A slat was broke door in bedroom 13	en out of the louvered closet				
	in good repair. Findings include: a. Handle missing bedroom 14, b. Finish worn off v	vation, furniture was not kept from drawer on night stand in vood furniture in bedroom 11, vood furniture in bedroom 14.				

DIVISION	of Fleath Service IN	guiation				
STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA AND PLAN OF CORRECTION IDENTIFICATION NUMBER:		L COM			E SURVEY	
AND FLAN	OF CORRECTION	IDENTIFICATION NOWIBER.	A. BUILDING: 01		COMPLETED	
			D. WING			
		HAL012004	B. WING		12/2	9/2015
NAME OF F	PROVIDER OR SUPPLIER	STREET ADI	DRESS, CITY, S	STATE, ZIP CODE		
MCAI PI	NE ADULT CARE	3806 KAT	HY ROAD			
MOALIN	TE ABOLI OAKL	MORGAN	TON, NC 28	655		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCED TO THE APPROI DEFICIENCY)	D BE	(X5) COMPLETE DATE
C 164	Continued From pa	ge 2	C 164			
	Based on observation, the HVAC return registers on the walls near the ceiling were very dirty.					
C 166	Housekeeping-Mair	ntained Free of Hazards	C 166			
	SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards; (e) This Rule shall apply to new and existing facilities.					
	This Rule is not met as evidenced by: 1. Based on observation there was a hasp and padlock on the closet doors in at least bedrooms 1,2,4,5,9,10 and 12. Latching hardware that can only be operated from one side of the door, such as hasps and padlocks, present the possibility that someone could be trapped in the closet.					
	wash wand in the B to reach the sink babreaker provided. Hare long enough to fixture present the p	vation, the hose on the hair eauty Salon was long enough usin and there was no vacuum closes on water fixtures that reach the flood rim of the possibility of siphoning into the water system unless is installed.				
	missing a plate in b	vation, an electrical outlet was edroom 10. Electrical outlets overs expose residents to				
	4. Based on observ	vation, a knockout was				

DIVISION OF PERSONS AND		()(0) 14111 TIT	E CONSTRUCTION	()(0) 5 4 7 7	OLIDVEY.	
		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION		(X3) DATE SURVEY COMPLETED	
	THE PERIOD CONTROL STATE OF TH		A. BUILDING: 01		COIVIFLETED	
			B WWG			
		HAL012004	B. WING		12/2	9/2015
NAME OF F	PROVIDER OR SUPPLIER	STREET AD	DRESS, CITY, S	STATE, ZIP CODE		
MCALDI	JE ADULT CADE	3806 KAT	HY ROAD			
WCALPII	NE ADULT CARE	MORGAN	TON, NC 28	655		
(X4) ID		TEMENT OF DEFICIENCIES ' MUST BE PRECEDED BY FULL	ID	PROVIDER'S PLAN OF CORRECTION SHOUL		(X5) COMPLETE
PRÉFIX TAG	•	SC IDENTIFYING INFORMATION)	PREFIX TAG	CROSS-REFERENCED TO THE APPRO		DATE
				DEFICIENCY)		
C 166	Continued From pa	ge 3	C 166			
	missing in a 4 inch	electrical junction box in the				
		aled openings in junction				
		ents to enrgized wires.				
		g				
C 189	Building Equipment	Maintained Safe, Operating	C 189			
	SECTION .0300 - F	NIVOLOAL DI ANIT				
	10A NCAC 13F .03					
	REQUIREMENTS	II OTTLER				
		d all fire safety, electrical,				
		umbing equipment in an adult				
		maintained in a safe and				
	operating condition.					
		apply to new and existing				
		ception of Paragraph (e)				
	which shall not app	ly to existing facilities.				
	This Rule is not me					
		vation the required one-hour				
		or ceilings were compromised				
		. Holes and penetrations that materials approved for use in				
		construction present the				
		that begins in one space can				
		her areas of the facility.				
	Findings include:	ŕ				
	a. Holes through th					
		ng tiles in the Medication				
	Department,					
		ng tiles in the kitchen,				
		ing tiles in the pantry, ing tiles in bedroom 9,				
		ng tiles in bedroom 10,				
	g. Broken ceiling til					
		in the janitor closet,				
		ve the water fountain near				
	bedroom 13 is only	one layer of ½ inch gypsum				
wall board,						

Division of Health Service Regulation

Division of Health Service Regulation							
	STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA AND PLAN OF CORRECTION IDENTIFICATION NUMBER:		(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01		(X3) DATE SURVEY COMPLETED		
		HAL012004	B. WING		12/2	9/2015	
NAME OF	PROVIDER OR SUPPLIER	STREET ADI	DRESS, CITY, S	STATE, ZIP CODE			
MCALPI	NE ADULT CARE	3806 KATI MORGAN	HY ROAD TON, NC 28	655			
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL) CROSS-REFERENCED TO THE APPRODEFICIENCY)	D BE	(X5) COMPLETE DATE	
C 189	Continued From pa	ge 4	C 189				
	 k. Portion of ceiling I. This facility is equal rated suspended content of the replaced in areas the provide verification are fire rated tiles. 2. Based on observed evices on the cross partition doors released tivation but then all alarm system was seen activation. 	outside housekeeping room, a missing in weight room, uipped with a one hour fire eiling system. Tiles have been broughout the facility. Please that the replaced ceiling tiles wation, the magnetic hold open as-corridor fire and smoke ased the doors on fire alarm re-energized when the fire silenced. The magnetic hold					
	alarm system is full 3. Based on interviand an owner, work above the suspending system. The work is duct mounted smokmaintenance persolocations of the duct Without knowing the they could not be in are not periodically cause the duct determined the event of a fire.	ew with the maintenance staff that has recently been done ed ceilings on the fire alarm included installing or moving					
	emergency lights in beauty salon would Battery powered en work properly for at endanger the reside 5. Based on obser- doors are not equip	the weight room and the not work when tested. nergency lights that will not least 90 minutes could					

Division of Health Service Regulation STATE FORM

of fire and smoke. Corridor doors that do not

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:				DATE SURVEY COMPLETED	
	HAL012004		B. WING		12/29/2015		
NAME OF F	PROVIDER OR SUPPLIER	STREET ADI	DRESS, CITY, S	STATE, ZIP CODE			
MCALPII	NE ADULT CARE	3806 KAT	_	CEE			
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCED TO THE APPROFILIENCY)	D BE	(X5) COMPLETE DATE	
C 189	Continued From pa	ge 5	C 189				
	that a fire that begin	nd latch present the possibility as in one space can quickly or and the remainder of the					
	6 Based on observation, the exterior light at the exit near bedroom 17 would not work. Unilluminated exit paths could delay an evacuation in an emergency.						
	relief valve on the w housekeeping room	vation, the ¾ inch pressure vater heater in the outside n was piped with ½ inch pipe. es must be connected with le as the valve.					
		vation, a roof gutter was ed outside the exit near the					
	mounted to the floo	vation a toilet was loosely r in the small men's bathroom. ause leaking and/or fall					
		rvation another toilet in the om was "out of order."					
C 191	Unvented & Portab	le Elec. Heaters Prohibited	C 191				
	maintain 75 degree winter design condi following shall apply appliances.						

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:				DATE SURVEY COMPLETED	
		HAL012004	B. WING		12/2	9/2015	
NAME OF F	PROVIDER OR SUPPLIER	STREET ADI	DRESS, CITY, S	STATE, ZIP CODE			
MCALPIN	NE ADULT CARE	3806 KATI					
0(0) ID	CLIMMA DV CTA	TEMENT OF DEFICIENCIES	TON, NC 28		ON!	0/5)	
(X4) ID PREFIX TAG	(EACH DEFICIENCY	MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCED TO THE APPROPERTION OF T	D BE	(X5) COMPLETE DATE	
C 191	Continued From pa	ge 6	C 191				
	(k) This Rule shall facilities with the ex	aters are prohibited. apply to new and existing ception of Paragraph (e) ly to existing facilities.					
	Based on observati to the prohibition of Portable electric he hazard and as such the facility. Finding includes:	on the facility failed to adhere portable electric heaters. aters are a potential fire a could effect all occupants of neater was found in use in the					
C 195	Hot Water System		C 195				
	provide an adequat kitchen, bathrooms closets and soil utili temperature at all fi be maintained at a (38 degrees C) and F (46.7 degrees C). (k) This Rule shall facilities with the ex	system shall be of such size to e supply of hot water to the , laundry, housekeeping ty room. The hot water xtures used by residents shall minimum of 100 degrees F shall not exceed 116 degrees					
	water leak in the bo	et as evidenced by: on, there was a serious hot iller room. Because of the to the kitchen had to be turned					

6899

Division of Health Service Regulation						
	IT OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01		(X3) DATE SURVEY COMPLETED	
			A. BOILDING. VI			
		HAL012004	B. WING		12/2	9/2015
NAME OF	PROVIDER OR SUPPLIER	STREET ADI	DRESS, CITY, S	STATE, ZIP CODE		
MCALPI	NE ADULT CARE	3806 KAT				
		MORGAN	TON, NC 28	655		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES ' MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCED TO THE APPROI DEFICIENCY)	D BE	(X5) COMPLETE DATE
C 199	Continued From pa	ge 7	C 199			
C 199	Exhaust Ventilation		C 199			
	provided with exhautwo cubic feet per in requirement does in before April 1, 1984 these specified spa (1) soiled linen stor (2) soil utility room; (3) bathrooms and (4) housekeeping (5) laundry area. (k) This Rule shall facilities with the exwhich shall not app This Rule is not me Based on observating maintain required expon-functioning extunhealthy buildup obacteria. Findings include; a. The exhaust fan housing in the bath b. The exhaust sysin the janitor closet.	ed in this Paragraph shall be ust ventilation at the rate of ninute per square foot. This ot apply to facilities licensed with natural ventilation in ces: rage; toilet rooms; closets; and apply to new and existing ception of Paragraph (e) by to existing facilities. et as evidenced by: on the facility failed to exhaust in a working condition. In aust could cause an femoisture and possibly was removed from the room off the kitchen. Item provided was not working tem provided was not working tem provided was not working				